

Testcertificaat Particle Penetration

Datum	6 mei 2020
Inkoopnummer	300352
Lotnummer	751-B
Productnaam	958
Leverancier	na
Type mondmasker	FFP2

Voor het bepalen van de deeltjesdoorlaat van de mondmaskers zijn er testen uitgevoerd op 3 verschillende maskers. Per masker zijn er minimaal 5 metingen uitgevoerd. Onderstaand de gemiddelden van de 5 metingen per masker.

Klasse indeling conform NEN-EN 149

FFP 1	: $\geq 80\%$
FFP 2	: $\geq 94\%$
FFP 3	: $\geq 99\%$

Test medium	NaCl
Flow	95 l/min


	Gemiddelde rendement voor deeltjes $\geq 0,3\mu\text{m}$	Pass or Fail t.o.v. P1/P2/P3 $\geq 0,3\mu\text{m}$	Gemiddelde rendement voor deeltjes $\geq 0,5\mu\text{m}$	Pass or Fail t.o.v. P1/P2/P3 $\geq 0,5\mu\text{m}$
Masker 1	73%	Fail	91%	Pass for P1
Masker 2	91%	Pass for P1	98%	Pass for P2
Masker 3	69%	Fail	91%	Pass for P1
Overall gemiddelde	78%	Fail	93%	Pass for P1

(Adem) weerstand over de maskers *

	Gemeten (Pa.)	Eis (Pa.)	Conclusie
Masker 1	117	< 240 Pa.	Pass
Masker 2	124		Pass
Masker 3	137		Pass

* weerstand is gemeten over een oppervlak van 44 cm^2 . Gerapporteerde waarde is de weerstand over een volledig masker ($44\text{ cm}^2 \times \text{factor } 3,3 = 150\text{ cm}^2$).

Eindoordeel (P1/P2/P3)



Naam 5.1.2e

Bijlage : Ruwe data

Bijlage : Ruwe data

Datum 6 mei 2020

Uitgevoerd door 5.1.2e

Inkoopnummer	300352
Lotnummer	751-B
Productnaam	958
Leverancier	na
Type mondkmasker	FFP2


Gebruikte apparatuur	
Aerosol generator	226 19 04 4C9
Deeltjesteller 1	X079-03
Deeltjesteller 2	X079-04
Anemometer	F024
Drukmeter	F011

Masker	Meting	Deeltjesgrootte	Upstream	Downstream	Rendement	Gemiddeld
4	1	≥ 0,3µm	247.762.047	65.148.496	73,71	73,42
	2		248.866.690	66.004.523	73,48	
	3		246.206.083	66.317.058	73,06	
	4		245.051.647	66.331.890	72,93	
	5		250.934.011	65.477.982	73,91	
	1	≥ 0,5µm	61.046.697	5.256.588	91,39	91,21
	2		60.849.995	5.328.630	91,24	
	3		60.042.348	5.385.133	91,03	
	4		59.582.551	5.413.385	90,91	
	5		61.536.159	5.232.574	91,50	

Masker	Meting	Deeltjesgrootte	Upstream	Downstream	Rendement	Gemiddeld
5	1	≥ 0,3µm	249.305.298	22.056.127	91,15	91,11
	2		249.143.910	22.087.911	91,13	
	3		247.432.208	22.018.694	91,10	
	4		248.182.998	22.265.543	91,03	
	5		249.156.623	22.104.862	91,13	
	1	≥ 0,5µm	61.365.589	1.233.541	97,99	97,95
	2		61.216.208	1.272.034	97,92	
	3		60.745.816	1.250.139	97,94	
	4		60.981.012	1.263.558	97,93	
	5		61.154.760	1.251.551	97,95	

Masker	Meting	Deeltjesgrootte	Upstream	Downstream	Rendement	Gemiddeld
6	1	≥ 0,3µm	253.429.345	77.481.083	69,43	69,34
	2		253.458.656	77.469.430	69,44	
	3		253.018.988	77.931.345	69,20	
	4		255.151.641	78.535.579	69,22	
	5		255.549.284	78.107.919	69,44	
	1	≥ 0,5µm	62.542.273	5.639.752	90,98	90,97
	2		62.272.469	5.542.636	91,10	
	3		62.473.057	5.687.427	90,90	
	4		62.744.980	5.701.199	90,91	
	5		62.953.336	5.704.731	90,94	

BIJLAGE 11

	During Production Inspection Report		Conclusion ?
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 1 / 44

I. GENERAL INFORMATION [How to read the report](#)

Client:	MJH International	
Supplier:	Rome International Handbag Company Limited	
Factory:	Rome International Handbag Company Limited	
Product Name:	KN95 PROTECTIVE MASK	
P.O. No.:	/	
Item No.:	KN95 EARLOOP	
Order Quantity:	2000000 pcs	
Sample Size:	500 pcs	
Man-day Quantity:	1 Man-day(s)	
Destination:	The Netherlands	
Inspection Date:	9 May 2020	
Re-Inspection:	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	
Reference Sample:	<input checked="" type="checkbox"/> Approval sample by Factory <input checked="" type="checkbox"/> Product Specification <input type="checkbox"/> P.O. <input type="checkbox"/> Packaging Spec.	
Available Quantity:	900000 pcs (Production Completion rate: 45% Packing Completion rate: 45%)	
Inspection Location:	Dongguan, Guangdong Province GPS Map (Longitude: 113.838609, Latitude: 23.093314)	

II. INSPECTION SUMMARY

	Passed*	Failed	Pending	Not Applicable
A. Quantity	✓			
B. Workmanship	✓			
C. On-Site Tests	✓			
D. Product Specification	✓			
E. Packing	✓			
F. Marking & Labeling	✓			
G. Client Special Requirements	✓			
H. Photos J. Videos new K. Form	Click on any title here to view more details.			

* The Passed results will be valid only after the client **notes and accepts** the issues in the following remarks.

AQL Result (AQL is the abbr. of Acceptance Quality Limits) [What is AQL](#)



Inspection Standard: Single sampling plan for Normal inspection according to ANSI/ASQ Z1.4-2008

AQL Acceptable Level: **Critical: Not Allowed, Major: 2.5, Minor: 4.0**

Inspection Sampling Level: **AQL Level III**

Sample Size: **500 pcs**

AQL Level	Sample Size	Acceptance	Actual Found	Result	AQL Result
-----------	-------------	------------	--------------	--------	------------

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 2 / 44

Critical:	Not Allowed	500	0	0	Passed	Within AQL
Major:	2.5	500	21	4	Passed	
Minor:	4.0	315	21	0	Passed	

* For detailed photos & description, please refer to Section B.

Client Special Requirements	
1.	Color, Material & Finish: Melt-blown fabric+no-woven fabric+hot air cotton
	Passed

* For detailed photos & description, please refer to Section G.

III. REMARKS

Problem Remarks - Need to be confirmed by client



- 160 (32%) out of 500 inspected samples were with uneven width of the edge. Please refer to below photos for details.
- The actual unit was different from the reference sample. Please refer to below photos for details.

3.	There were 3 different types of mask among the inspected samples, details was as below:				
	No.	KN95 marking	The layer number	QTY (sample size 500pcs)	Internal check from outer to inner
	1	Only on left sides	5	36	No-woven fabric(56gsm) Melt-blown fabric (24gsm) Melt-blown fabric (24gsm) Hot air cotton (44gsm) No-woven fabric (32gsm)
	2	Only on right sides	5	440	No-woven fabric(52gsm) Melt-blown fabric (28gsm) Melt-blown fabric (28gsm) Hot air cotton (44gsm) No-woven fabric (28gsm)
	3	On both sides	5	24	/



- The factory could not provide scale to do the carton gross weight check.
- The factory could not provide required equipment to do filtering efficiency test, bacterial Filtration Efficiency test or Airflow resistance test.


General Remarks - For client reference

- Date of production was April 22, 2020 printed on certification and carton.


	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 3 / 44

7.	There was Chinese characters on the certification.
8.	No CE marking was found on unit and carton.
9.	There was factory LOGO on carton and poly bag.
10.	There was no silica gel inside the package/export carton.
11.	There was no calibration label on scale factory provided for weight check, and the calibration work was conducted by inspector.
12.	When the inspector left the factory, the factory had not started repacking the inspected samples.
13.	<p>Base on our finding of materials/accessories/semi-finished products/finished products/the production line, we recommend the manufacturer to make improvement or pay attention on follow up mass production:</p> <ul style="list-style-type: none"> - Pay more attention and improve the self-inspection on the defectives: <u> </u>. - Pay more attention to <u> </u>. - Improve the frequency/standard of inspection on process of <u> </u>. - Keep the production lines clean and tidy. - Lubricate and maintain the production machines well to ensure it in a good condition. - Array and stock raw materials/semi-finished products/finished products in good order to avoid confused or damaged. - Identify the defective products with marking / labeling to avoid it mixed with the conforming product. - To ensure the reworked and repaired products being re-inspected before release. - Promote the ability/skill/ awareness of inspector. - Make more training/explaining on main points of requirements to operators for process: <u> </u>.
14.	The factory was requested to repair/replace the defective products our inspector found during the inspection.
Factory Information	
15.	<p>Factory cooperation:</p> <p><input type="checkbox"/> Good - Enough manpower to assist, and good cooperation.</p> <p><input checked="" type="checkbox"/> Average - Enough manpower to assist.</p> <p><input type="checkbox"/> Poor - Manpower, equipment or document not provided timely.</p>
16.	<p>Number of workers in factory:</p> <p><input type="checkbox"/> Less than 50 people</p> <p><input type="checkbox"/> 50-100 people</p> <p><input type="checkbox"/> 100-500 people</p> <p><input type="checkbox"/> 500-1000 people</p> <p><input type="checkbox"/> More than 1000 people</p> <p><input checked="" type="checkbox"/> Unknown</p>
17.	<p>The observed level of production/manufacturing activity at the inspection site was:</p> <p><input type="checkbox"/> Extremely busy</p> <p><input checked="" type="checkbox"/> Normal activity</p> <p><input type="checkbox"/> Low activity / No production</p> <p><input type="checkbox"/> N/A (Reasons: Inspection was held at warehouse or port. / Inspector had no access to workshops. / Factory was unwilling to disclose information, etc)</p>
18.	<p>Inspector's opinion on the factory:</p> <p><input type="checkbox"/> Good - The factory was neat and tidy. The testing equipment was well maintained and calibrated.</p> <p><input checked="" type="checkbox"/> Average - The factory was tidy, and the testing equipment ran normally.</p> <p><input type="checkbox"/> Poor - The factory was messed, the basic testing equipment was not available / not workable.</p>
Sample Collection Record	
19.	70 production sample(s) & 0 defective sample(s) were collected and sent to V-Trust head office.
Photos:	


	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 4 / 44

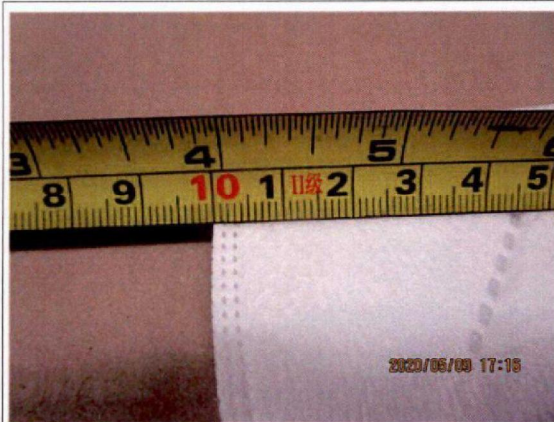


↑ 1 - Remark 1, uneven width of the edge

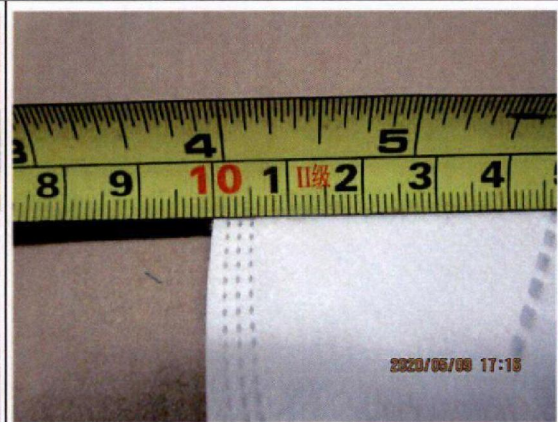


↑ 2 - Remark 1, uneven width of the edge

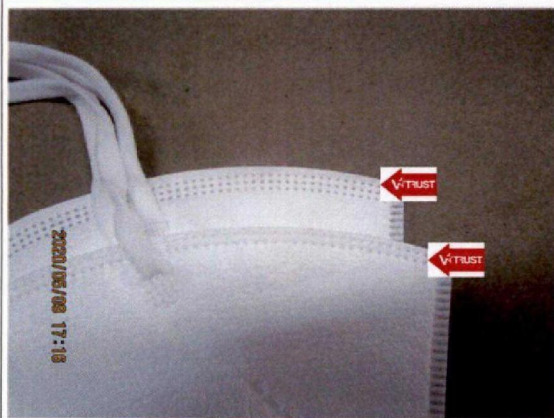


↑ 3 - Remark 1, uneven width of the edge

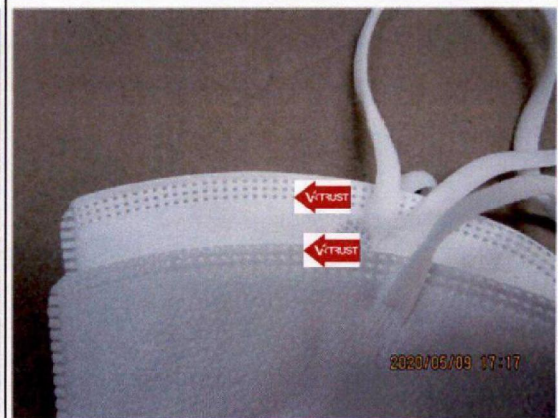


↑ 4 - Remark 1, uneven width of the edge

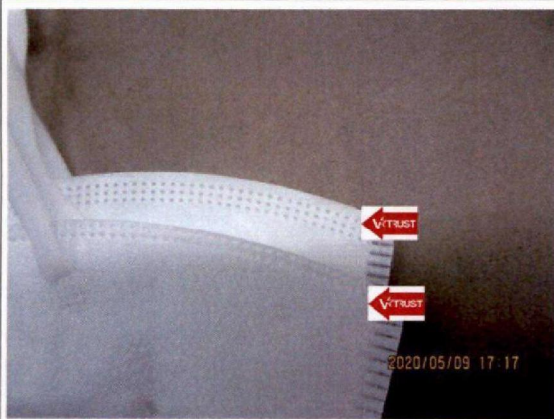

↑ 5 - Remark 1, uneven width of the edge

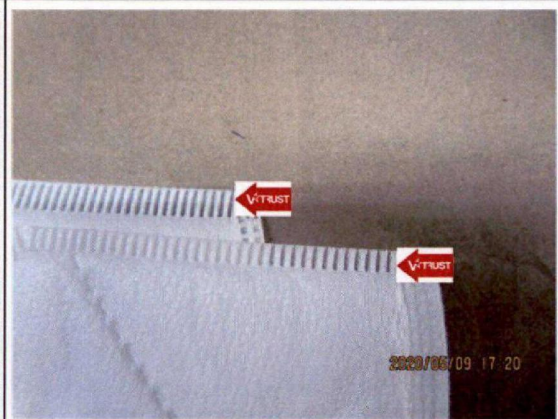


↑ 6 - Remark 1, uneven width of the edge

	During Production Inspection Report		Conclusion ^①
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 5 / 44



↑ 7 - Remark 1, uneven width of the edge

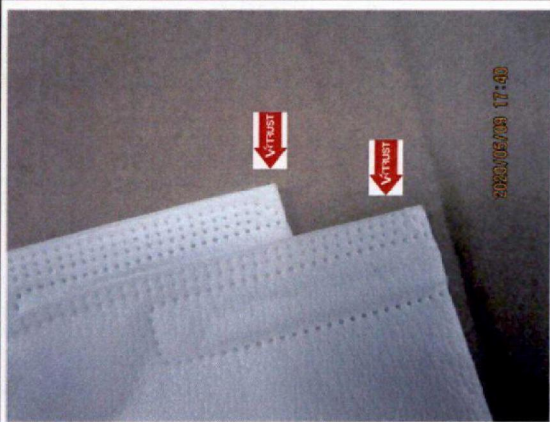


↑ 8 - Remark 1, uneven width of the edge




↑ 9 - Remark 2, the actual unit was different from the reference sample (the left one was sample)




↑ 10 - Remark 2, the actual unit was different from the reference sample (the left one was sample)

	During Production Inspection Report		Conclusion ^②
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 6 / 44

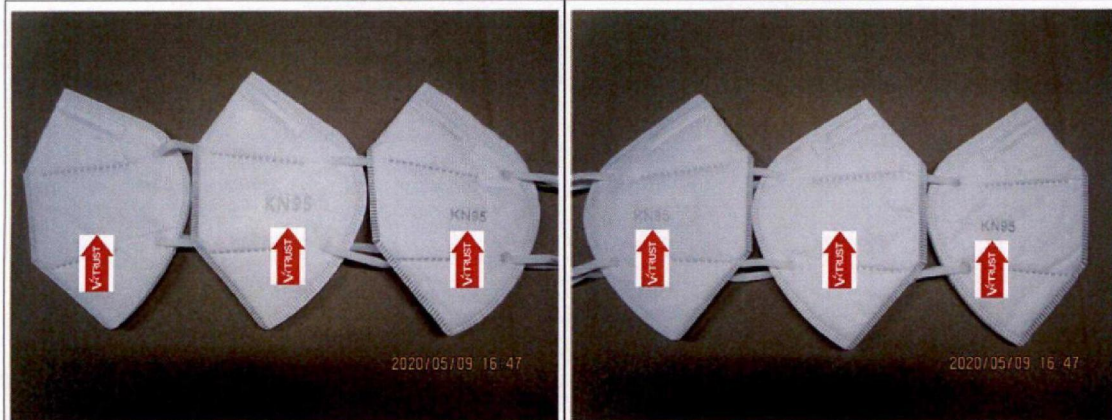


† 11 - Remark 3, there were 3 different types of mask among the inspected samples

† 12 - Remark 3, there were 3 different types of mask among the inspected samples

	During Production Inspection Report		Conclusion ⓘ
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 7 / 44

IV. CONCLUSION

PASSED
(Conditional)

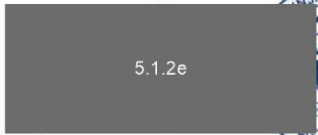

Approved by: 5.1.2e

The meaning of conclusion:

- PASSED** - The inspected samples conform to the client's requirements.
The shipment may be released after getting the client's approval.
- PASSED (Conditional)** - The Passed result will be valid only after the client notes and accepts the issues in the remarks.
The shipment may be released after getting the client's approval.
- PENDING** - The client should evaluate the issues in the remarks, and then decide to approve or reject the shipment.
- FAILED** - There will be risks if the shipment is released in this condition. A re-inspection is suggested after the failed problems are solved. However the client has the final decision to approve or reject the shipment after considering different factors.


Will you approve and release this shipment?

Approve

Reject

1. After logging in, you may click the above button to inform the supplier of your decision simply.
2. You may still edit the message sent to your supplier online.
3. You may also get the statistics of all your inspections on [Dashboard](#).

Inspector & Report Reviewer:



	During Production Inspection Report		Conclusion ^⑦
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 8 / 44



Should you have any question, please contact us:			
5.1.2e	5.1.2e	5.1.2e	5.1.2e
5.1.2e	E: 5.1.2e @v-trust.com	5.1.2e	E: 5.1.2e @v-trust.com
	T: 5.1.2e		T: 5.1.2e
	M: 5.1.2e		M: 5.1.2e

— This is the end of Inspection Summary. —


Please find our inspection details from next page of each Section, Checklist.

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 9 / 44



A. QUANTITY

Quantity										Unit: pcs	
P.O.	Item	Order Qty	Qty/Carton	Order Carton	Quantity Breakdown			Sample Size			
					Packed	Unpacked	Unfinished	Packed	Unpacked		
/	KN95 EARLOOP	2000000	1500	1334	900000	0	1100000	500	0		
Total:		2000000	-	1334	900000	0	1100000	500	0		
Selected Cartons											
Carton Quantity Available: 1334 cartons											
Completion rate: 45%											
Selected Cartons: 30 cartons											
No carton number in shipping mark.											
Item	Carton Number										Total
KN95 EARLOOP	/	/	/	/	/	/	/	/	/	/	30 CTN
Spare Parts & Quantity Check											
Were there any spare parts on site for checking?										No	
Did the spare parts quantity conform to the client's list/specification?										N/A	
Is the order quantity consistent with the quantity in packing list?										N/A	
Result: Passed											
Remark:											

B. WORKMANSHIP





 What is AQL

Inspection Standard: Single sampling plan for Normal inspection according to ANSI/ASQ Z1.4-2008							
Inspection Level	Sample Size	AQL		Acceptance	Actual Found	Result	
Level III	500 pcs	Critical:	Not Allowed	0	0	Passed	
		Major:	2.5	21	4	Passed	
		Minor:	4.0	21	0	Passed	
Workmanship Defectives / Function Inspection Findings							
Description					Critical	Major	Minor
For Item: KN95 EARLOOP					Sample size: 500 pcs		
1.	Poor seaming on edge					1	
2.	Booken mask Rope (Pull the rope by hand with normal force)					3	
Sample Size:					500	500	315
Acceptance:					0	21	21
Actual Found:					0	4	0
Note: Only one most serious defect is taken into account per each defective unit.							
Result: Passed (Conditional)							



	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 10 / 44

Remark: - 160 (32%) out of 500 inspected samples were with uneven width of the edge.



1 Defect photos of Items: KN95 EARLOOP

 <p>↑ 13 - Poor seaming on edge - major</p>	 <p>↑ 14 - Broken mask Rope (Pull the rope by hand with normal force) - major</p>
 <p>↑ 15 - Broken mask Rope (Pull the rope by hand with normal force) - major</p>	 <p>↑ 16 - Broken mask Rope (Pull the rope by hand with normal force) - major</p>



C. ON-SITE TESTS					
	Description	Sample Size	Passed	Failed	Result / Reading
1.	Conformity Check - Compare with all clients' files and approval sample. Including style and color, material and hand feel, logo, accessories. - Conform to client's requirement	Full 500 pcs			Passed (Conditional)

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 11 / 44



2.	Color Shade Check - Check the unit from piece to piece and within same unit. - Pending overall result if found lot shade at gray scale 4 or below gray scale 4	Full 500 pcs	500	0	Passed
3.	Fabric Weight Check - 1. Used equipment: Electronic balance (0.1g), cutting die. - 2. Use cut machine to cut a 0.01square meter (circle or square) each layer material from the product - 3. Weight the specimen and count average weight per swatch. - 4. The weight (g) per square meter =100 x g (average weight). - -Within client requirements; - -If no client tolerance, accept if the difference is within +/- 5%; - -If out of 5%, remark and pending report; - -If no client spec given, record actual finding only.	1 pcs			Actual Finding
4.	Seaming Strength Test - Pull the seaming by hand with normal force - No breakage when pulling	Full 500 pcs	500	0	Passed
5.	Accessory Fastness Test - Pull the accessory by hand with normal force - No breakage or detachment	Full 500 pcs	497	3	Passed
6.	Smell Check - Smell by nose within 3cm - Should be as the client requirement, no odor.	Full 500 pcs	500	0	Passed
7.	Rub Check - Use cotton dripped with water, rub the marking on silk-screen printing by hand for 15 seconds. - Printing is clear after the rub	2 pcs	2	0	Passed
8.	Carton Drop Test - One corner, three edges, six sides, at height of - 30inch (9.5kg) - 24inch (9.5kg~18.6kg) - 18inch (18.6kg~27.7kg) - 12inch (27.7kg~45.3kg) - 8inch (45.3kg~68kg) on the cement floor. - No unit drop out, No any damage on unit.	1 carton	1	0	Passed

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 12 / 44

9.	Fitting Check - Wear the products, verify comfortable level of the products and adhered force of accessories. - Good fitting and no failure is found	2 pcs	2	0	Passed
10.	Internal Check - Cut the product apart and separate the layers of material ; - Check the cleanliness ; - Check the strength by pulling the material with appropriate force - The product should include at least 3 layers; - There must be a layer of melt-blown non-woven fabric by polarity surface check - All materials are cleaned and strong enough	1 pcs	1	0	Passed
11.	Polarity Check - -Prepare some paper scraps smaller than 1x1cm - -Fully contact the melt-blown material with paper scraps; - -Gently lift the melt-blown material and observe the adsorption effect of paper scraps - -The paper scraps should be with obvious polar adsorption effect on melt-blown materials	1 pcs	1	0	Passed
12.	Combustion Test - Test individually with each layer of material (Not applicable for filter sponge) - After the flame touching the material for about 3s, and leaves the product without flame - Observe the flammability of the material - After leaving the flame, it is passed that the material is qualified to extinguish within 3 seconds - If the material is qualified to extinguish, but the extinguish time is beyond 3s, please remark the time, and the result should be passed conditional - If the material could not be extinguished, the result would be failed.	1 pcs	1	0	Passed
13.	Nose Clip Check - The mask should be fitted with a nose clip which is adjustable - No failure	Full 500 pcs	500	0	Passed

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 13 / 44


14.	Mask Rope Check - The mask rope is easy to adjust and should be with enough strength to fix the mask. Pull the mask rope with 10N force without breaking - No failure	3 pcs	3	0	Passed
15.	Particle Filtration Efficiency (EN149) - Per filtering efficiency tester - Under the condition of gas flow is 95 L/min, masks for non-oily particle filtration efficiency should comply with the requirements of table - Grade Filtering efficiency(%) - FFP1 >=80 - FFP2 >=94 - FFP3 >=99 - Conform to requirement	0			Not Tested
16.	Bacterial Filtration Efficiency test (BFE) (EN14683) - Check the certificate or test report - Bacterial efficiency should comply with the requirements of table - TPYE BFE(%) - I >=95 - II >=98 - II R >=98 - Conform to requirement	0			Not Tested
17.	Breathing Resistance(EN149) - Per airflow resistance tester - Exhalation valve flow (30 & 95 L/min) (mbar) - FFP1 <= 0.6/2.1 - FFP2 <=0.7/2.4 - FFP3 <=1.0/3.0 - Exhalation valve pull (160 L/min) - <= 3.0 - No failure	0			Not Tested

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 14 / 44

18.	Surface Wet Resistance Test - Tighten the melt-blown process material on a plane with a 45 degree angle slope - Using 250 ml water, dripping evenly on the material surface within 25s - Observe the wet area on the material after the test - Wetting at the sprinkling points on the sample surface, or no any wetting	1 pcs	1	0	Passed
19.	Information Of Manufacture check - Check the production date and name of manufacture whether is found on product or package - The information should be clear and corrective, otherwise the result should be failed	1 pcs	1	0	Passed
20.	Test Report Review - Factory should provide test report for review - No failure	1 pcs	1	0	Passed
21.	Water repellent test - Sprinkle water on the surface (body and seam) of the product, Wait five minutes and check if the water permeate the reverse. - if water permeate the reverse, the test is failed.	2 pcs	2	0	Passed
Result:		Passed (Conditional)			
Remark:	- The actual unit was different from the reference sample. - There were 3 different types of mask among the inspected samples. - The factory could not provide required equipment to do filtering efficiency test, bacterial Filtration Efficiency test or Airflow resistance test.				

* Refer to V-Trust Work Instruction: VTR-WI-CZ-1002.

D. PRODUCT SPECIFICATION					
	Client Spec.	Ref. Sample	1# Sample	2# Sample	3# Sample
Item No.:	KN95 EARLOOP				
Folded size LxW (cm)	15.5x10.5	15.7x10.7	15.7x10.7	15.6x10.7	15.7x10.6
Opening width (cm)	/	18.8	18.8	18.9	18.7
Length of mask rope (cm)	/	/	18.7	18.8	18.6
Net Weight (g)	/	5.36	5.24	5.2	5.19

	During Production Inspection Report		Conclusion ^②
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 15 / 44

Result:	Passed
Remark:	

E. PACKING

Package Details



Item No.	Qty/Carton		Carton Size (L x W x H, cm)		Gross Weight (kgs)		Qty / Inner box	
	Marking / Spec.	Actual	Marking / Spec.	Actual	Marking / Spec.	Actual	Marking / Spec.	Actual
KN95 EARLOOP	1500	1500	68x36x39.5	68.5x37x40	10	/	/	/

Export Carton Details

Fastening Metal Staples	No	Nylon Band	No
Material	Cardboard	Corrugated Paper Piles	5-ply

Packing Method

10 pcs of units were packed into a poly bag as a pack, then 150 packs were packed into a master carton.

Assortment Method

No assortment

Result: Passed (Conditional)

Remark: - The factory could not provide scale to do the carton gross weight check.

F. MARKING & LABELING

Barcode/Labeling/Printing

Name	Location	Result
Item number	Unit, Carton, Polybag	Passed
Instruction manual and documentation check	Provided by	
-		

Shipping Marks



Shipping Marks (on 2 sides)	Actual Finding
Side Marks (on 2 sides)	Actual Finding
Inner Box Marks (on / side)	N/A

Result: Passed

Remark:

G. CLIENT SPECIAL REQUIREMENTS

	Client Requirements	Result
1.	Color, Material & Finish: Melt-blown fabric+no-woven fabric+hot air cotton	Passed

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 16 / 44

Result:	Passed
Remark:	

H. PHOTOS

Photos of Item: KN95 EARLOOP



↑ 17 - Export Carton




↑ 18 - Export Carton




↑ 19 - Shipping mark




↑ 20 - Shipping mark


	During Production Inspection Report		Conclusion ^②
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 17 / 44

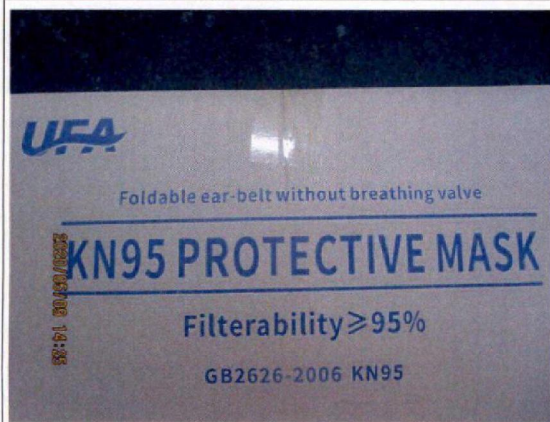


↑ 21 - Detail

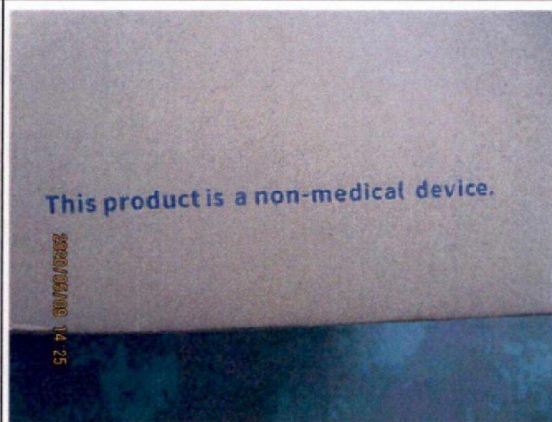


↑ 22 - Detail

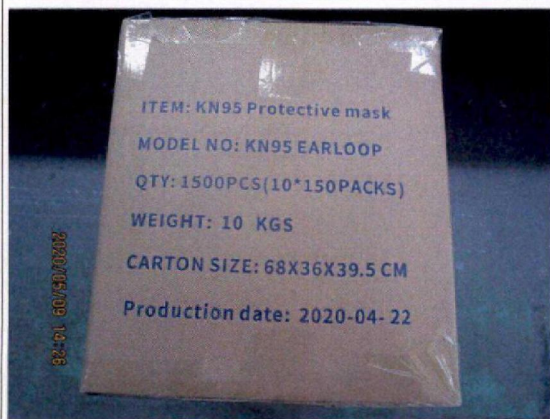

↑ 23 - Side mark

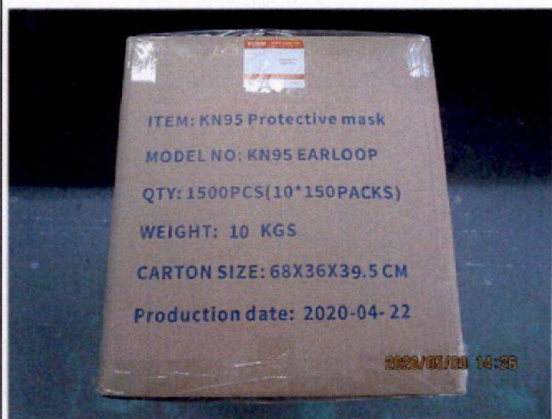

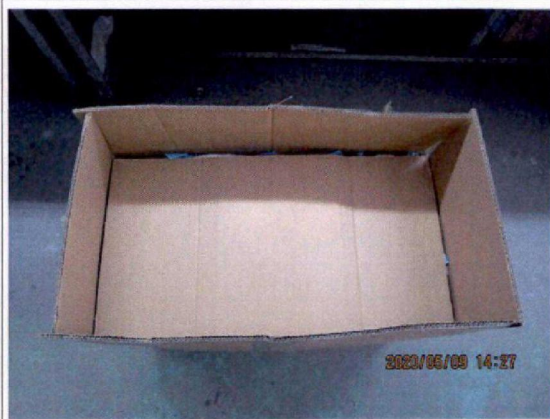

↑ 24 - Side mark



↑ 25 - Open carton



↑ 26 - 5-ply carton

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 18 / 44



↑ 27 - Open carton




↑ 28 - Polybag



↑ 29 - Detail




↑ 30 - Detail

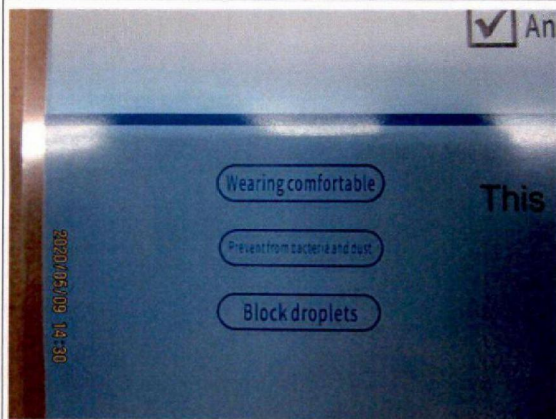

↑ 31 - Detail




↑ 32 - Detail


	During Production Inspection Report		Conclusion ^①
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 19 / 44




↑ 33 - Polybag

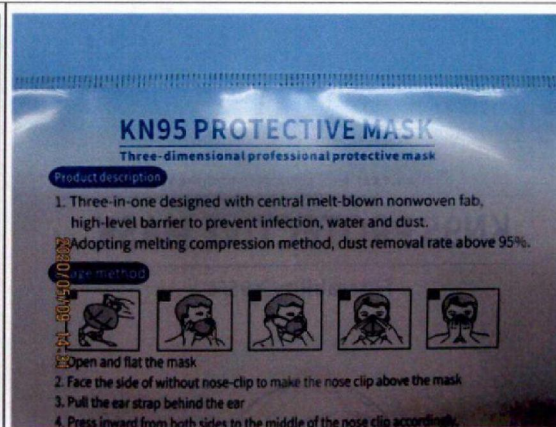

↑ 34 - Detail

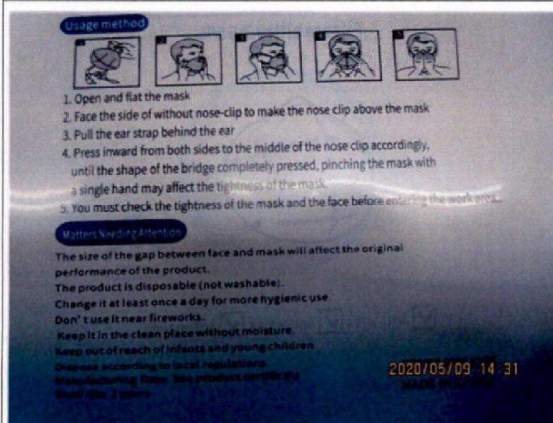

↑ 35 - Detail

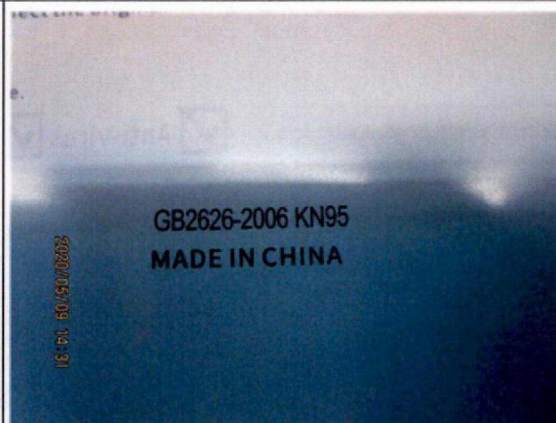


↑ 36 - Detail



↑ 37 - Unit packing



↑ 38 - Unit

	During Production Inspection Report		Conclusion ^②
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 20 / 44



↑ 39 - Certificate




↑ 40 - Unit view



↑ 41 - Unit view



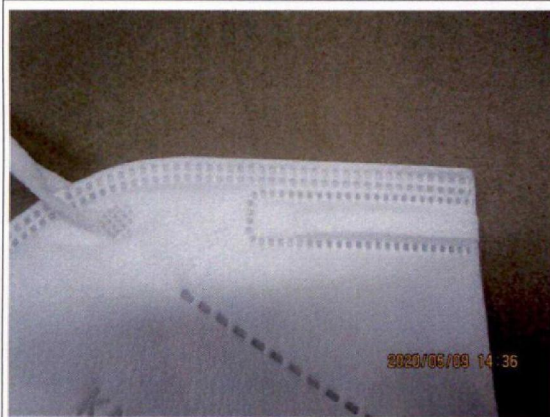

↑ 42 - Unit view



↑ 43 - Unit view




↑ 44 - Unit view

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 21 / 44




↑ 45 - Unit view

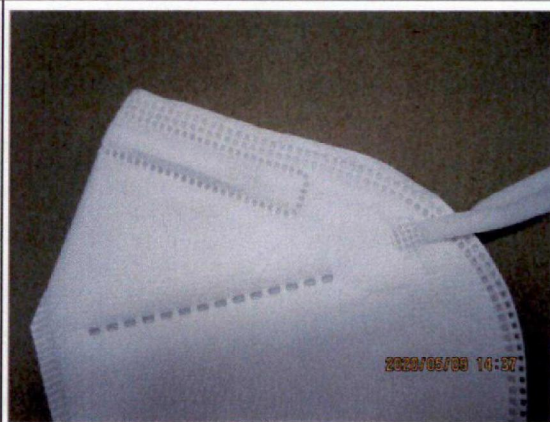


↑ 46 - Unit view




↑ 47 - Unit view

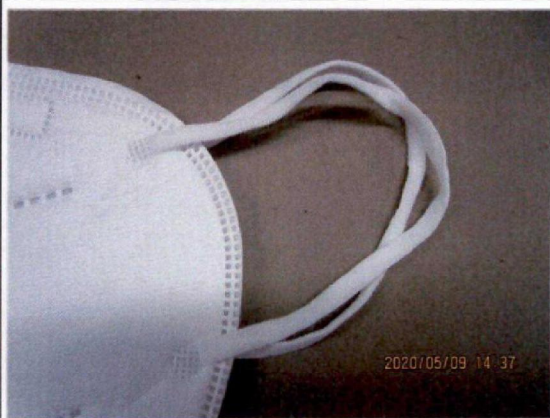


↑ 48 - Unit view

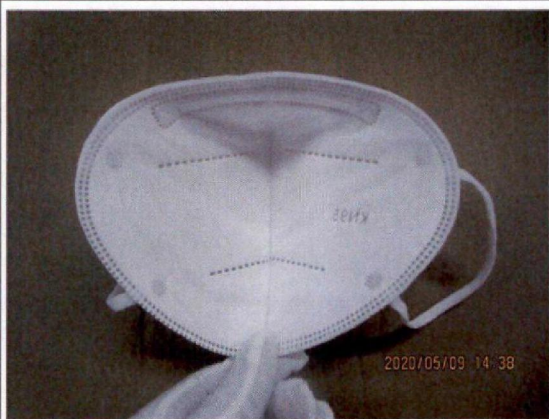

↑ 49 - Unit view

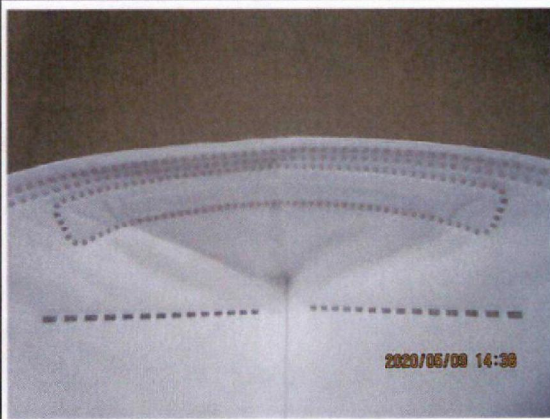


↑ 50 - Unit view

	During Production Inspection Report		Conclusion [Ⓢ]
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 22 / 44



↑ 51 - Unit view

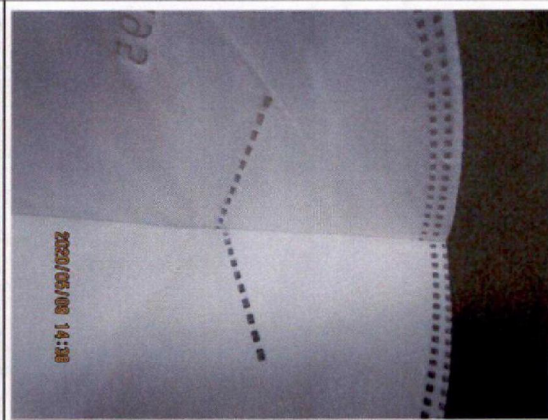

↑ 52 - Unit view



↑ 53 - Unit view





↑ 54 - Unit view




↑ 55 - Compare with reference sample (the left one)



↑ 56 - Compare with reference sample (the left one)

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 23 / 44

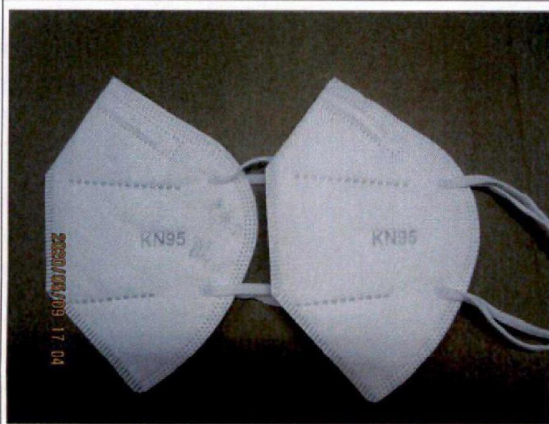

† 57 - Compare with reference sample (the left one)




† 58 - Compare with reference sample (the left one)



† 59 - Size check



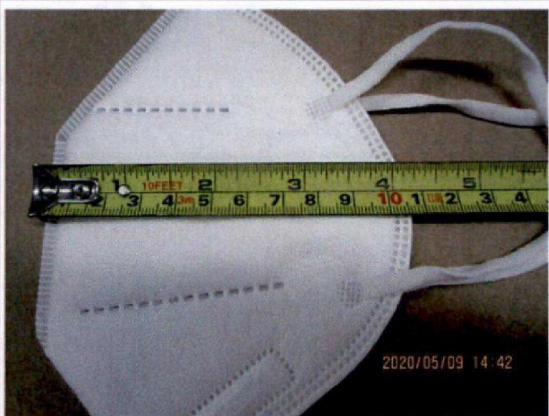

† 60 - Size check




† 61 - Size check



† 62 - Size check


	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 24 / 44

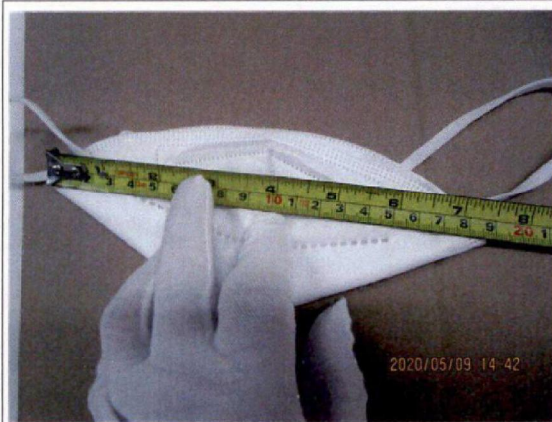


† 63 - Size check




† 64 - Size check

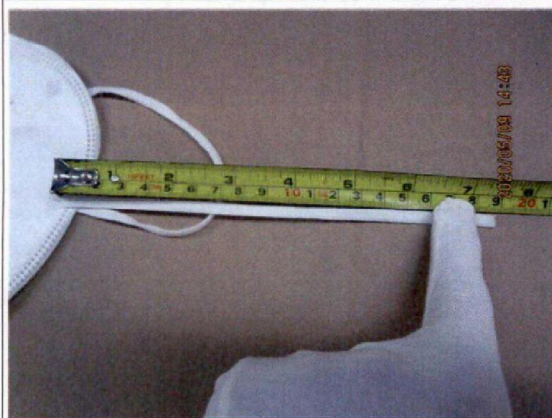


† 65 - Size check

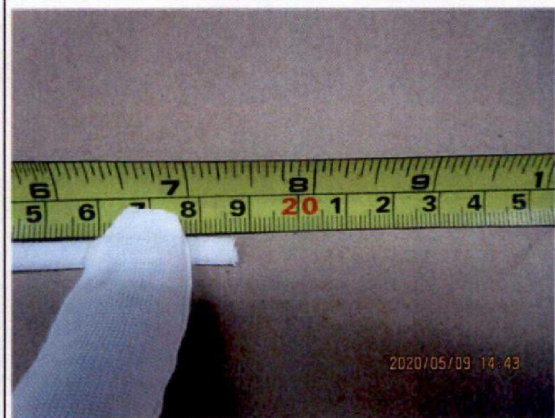

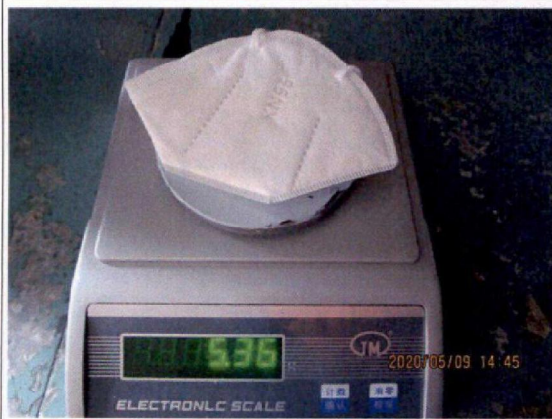

† 66 - Size check

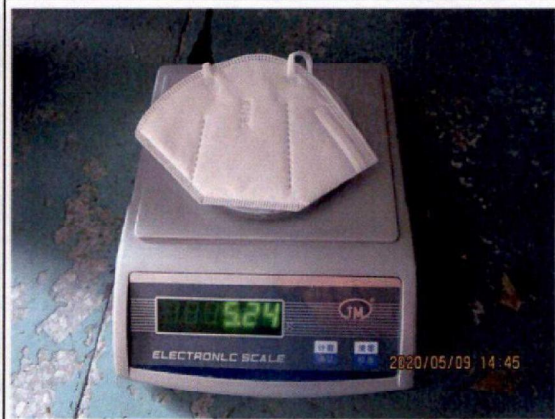

† 67 - Unit weight (sample)



† 68 - Unit weight

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 25 / 44



↑ 69 - Unit weight



↑ 70 - Unit weight



↑ 71 - Size check





↑ 72 - Size check




↑ 73 - Size check



↑ 74 - Size check

	During Production Inspection Report		Conclusion 
	Client (abbr.):	MJH International	PASSED (Conditional)
	Report Number:	Q51594EY	
	Report Date:	9 May 2020	Page 26 / 44

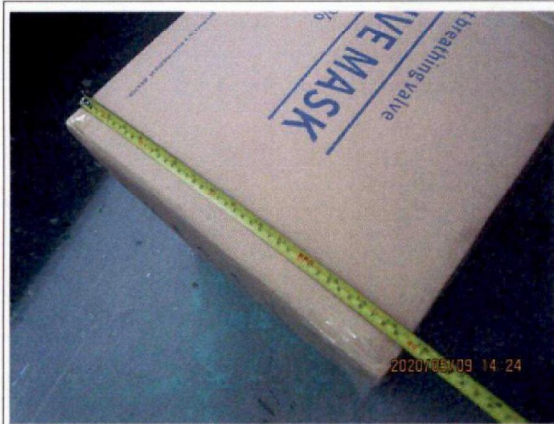

† 75 - Size check



† 76 - Size check

Photos of On-Site Tests



† 77 - Conformity Check



† 78 - Conformity Check