

ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase I,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 5.1.2e@hkg.admgroup.com

FINAL INSPECTION REPORT



Date: 05 (D) 05 (M) 2020 (Y)	Time : In 08:10 / Out 18:00	Submission: ① <input checked="" type="checkbox"/> / ② <input type="checkbox"/> / ③ <input type="checkbox"/> / ④ <input type="checkbox"/>	Report no.: ADM 0057162
--	---------------------------------------	--	--------------------------------

Vendor : GREAT WAVE TECHNOLOGY MANUFACTURING CO LTD		Maker Name match to PO: <input checked="" type="checkbox"/> Y / <input type="checkbox"/> N	
Maker Name: 江苏南方卫材医药股份有限公司		Maker Address match to PO: <input checked="" type="checkbox"/> Y / <input type="checkbox"/> N	
Item Description: FFP2 MASK EN149:2001 +A1:2009			
PO No.: MB 579082	Indent No. : P-TRDNL02000005	Art. no.: HMSN95	Order Qty: 1000080 <input checked="" type="checkbox"/> Pieces <input type="checkbox"/> Sets <input type="checkbox"/> Ctns

Inspection Qty: 272160		Number of Carton: 378		Sampling for inspected		Inspected carton number:	
Packed	Un-packed	Packed	Un-packed	Qty	No. of Carton	No number on carton	
5.1.1c	0	5.1.1c	0	800	20		

Inspection Summary	OK	NG	Pending		OK	NG	Pending		OK	NG	Pending
1. Critical Safety :	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
2. Workmanship/Functional	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
3. Logo & Finishing:	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
4. Packing and marking:	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
5. Data measurement:	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
6. A/S ready:	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
7. Lab test result	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
8. Others:											

Overall Inspection Result: Accepted: / Conditional Accepted: / Pending: / Rejected:

A. Workmanship and functional inspection	Inspection Standard: ANSI / ASQ Z1.4 – 2008; Single sampling plans for normal inspection level: <input type="checkbox"/> III / <input checked="" type="checkbox"/> II / <input type="checkbox"/> I				
	Acceptable Quality Level (AQL): Critical Safety: <u>Not allowed</u> ; Critical functional: <u>0.4</u> ; Major + Critical functional: <u>1.0</u> ; Minor: <u>2.5</u> ;				
No.:	Defects Description	CRS	CRF	Major	Minor
1	Black dot		2		
2	Ear loop come off		1		
3	Nose clip welding not well		1	1	
4	Poor printing			4	
5	Nose clip slant				11
6	Puckering				2
7	Ear loop welding not well				2
Total Defects Found		0	4	5	15
Maximum Allowed		0	7	14	21

B. Logo and Finishing

Logo & Unit body finishing & position compare to A/S: <input checked="" type="checkbox"/> OK / <input type="checkbox"/> NG	A/S stay in the factory <input checked="" type="checkbox"/> / Kept in QC <input type="checkbox"/> office <input type="checkbox"/>
Logo/body/packaging color compared with A/S in daylight: <input checked="" type="checkbox"/> OK / <input type="checkbox"/> NG	<u>1</u> Piece / Sets of SS to be kept in QC for ref
Inspection based on: <input checked="" type="checkbox"/> PO / <input checked="" type="checkbox"/> AS / <input type="checkbox"/> Photo / <input type="checkbox"/> Limit sample / <input type="checkbox"/> Other / <input checked="" type="checkbox"/> QAP # TRD010420D0202A	
<u> </u> / <u> </u> Pieces / Sets-of <input type="checkbox"/> SS / <input type="checkbox"/> DS to be sent to ADM <u> </u> / <u> </u> office for ref. by <input type="checkbox"/> Vendor / <input type="checkbox"/> Inspector	

Remark:
1: A.301CTN (5.1.1c), B.77CTN (5.1.1c), Total: 378CTN (5.1.1c)
2: Client: Mediq

The performance of inspection and subsequent issuance of inspection Report does not relieve supplier from their liability to assume full responsibility for merchandises containing any hidden and/or apparent defects so far exceeding AQL limits and / or in contravention of legal, health, safety regulations ascertained after arrival of merchandise at final destination.

ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase 1,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 5.1.2e@hkg.admgroup.com

FINAL INSPECTION REPORT**C. Packing method and Verification:**

--- 5.1.1c per poly bag, 5.1.1c bag per color box, 5.1.1c per master carton, 720pcs per carton.	
Master Carton	<input checked="" type="checkbox"/> Made in China / <input type="checkbox"/> Resy Logo / <input type="checkbox"/> Carton Label / <input checked="" type="checkbox"/> Metal staples / <input type="checkbox"/> Barcode label Taped method : <input type="checkbox"/> I / <input checked="" type="checkbox"/> H / <input type="checkbox"/> 王; With plastic Tie: <input type="checkbox"/> Yes / <input checked="" type="checkbox"/> No / Cardboard on: <input type="checkbox"/> Top; <input type="checkbox"/> Bottom
Inner-Mail-Box	<input checked="" type="checkbox"/> Made in China / <input type="checkbox"/> Recycle Mark / <input type="checkbox"/> Green Dot <input type="checkbox"/> Logo / <input type="checkbox"/> Barcode / <input checked="" type="checkbox"/> Ref. No.: Lot 20200406 <input checked="" type="checkbox"/> Closed by tape; <input type="checkbox"/> Top / <input type="checkbox"/> Bottom; / <input checked="" type="checkbox"/> Others : CE MARK
Poly bag /Bubble Bag	<input type="checkbox"/> Recycle Mark / <input type="checkbox"/> Green Dot / <input type="checkbox"/> Barcode / <input type="checkbox"/> Hole <input type="checkbox"/> Warning Text / <input type="checkbox"/> Ref. No.: Lot 20200406 <input type="checkbox"/> Closed by tape / <input checked="" type="checkbox"/> Closed by self-sticking / <input type="checkbox"/> Closed by heat seal / <input type="checkbox"/> Label
Main Unit	<input type="checkbox"/> Made in China / <input type="checkbox"/> Safety Mark / <input checked="" type="checkbox"/> Customer Logo : "FFP2" / <input checked="" type="checkbox"/> Others: CE MARK

D. On-site test and data measurement (According to QAP; P.O or Approval Sample)

Check point	Qty	Spec / Tolerance	Approval sample	Test result
Unit quantity in master carton	5.1.1c		N/A	720pcs/carton
Export carton size(cm)	5.1.1c		N/A	60x34.5x36cm
Export carton gross weight	5.1.1c		N/A	6.7 ~ 7.2kg
Transit test: drop for master carton packing	5.1.1c	68cm	N/A	Passed
Carton number check	5.1.1c		N/A	No number on carton
Cosmetic-Tape test	5.1.1c	Over 15% printed peel off failed	N/A	Passed
Performance-Fitting check	5.1.1c	Must fit the audit's head, easy to wear and remove 25 cycles per minute, 20 minutes, cannot be damaged	N/A	Passed
Performance -Nose clip check	5.1.1c	Each mask must be equipped with a nose clip, folded 50times repeatedly and must not break.	N/A	Passed
Performance -Ear loop tension test	5.1.1c	Apply 10N pull, the mask strap and the body cannot be separated. Stretch length should not be less than 2 times the length	N/A	Passed
Material-Flame retardant check	5.1.1c	After leaving the flame, continue to burn for no more than 5 seconds. (Molten cloth material)	N/A	Passed
Material- Humidity check	5.1.1c	Fabric humidity must under 10%	N/A	Passed
Material layer quantity check	5.1.1c	Main five layers. Two layers of non-woven cloth Two layer of molten cloth A layer of needle cotton	N/A	Passed
Laser light through test	5.1.1c	Filter layer (Molten cloth) should block the laser light, any light leak failed.	N/A	Passed

ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase I,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 5.1.2e@hk.admgroup.com

FINAL INSPECTION REPORT

Performance- Water leakage test	5.1.1c	Filled 20ml water in the mask keep for 4 hours, any slight leak was failed.	N/A	Passed
Lot code check	5.1.1c	20200406 on poly bag, inner box and master carton	N/A	Passed
Color fastness for rubbing	5.1.1c	For unit printing/markings: Rubbing all the markings/printings for 15 sec with a piece of dry cloth	N/A	Passed
Material thickness	5.1.1c	First non-woven cloth: > 0.3mm Second layers of molten cloth: >0.23mm The third layers of needle cotton: >0.28mm The fourth non-woven cloth: >0.3mm	First non-woven cloth: >0.27mm Second layers of molten cloth: > 0.23mm The third layers of needle cotton: > 0.28mm The fourth non-woven cloth: >0.28mm	First non-woven cloth: >0.3mm Second layers of molten cloth: >0.23mm The third layers of needle cotton: > 0.28mm The fourth non-woven cloth: >0.3mm
Material-Odour test	5.1.1c		N/A	Passed
Performance - Size check	5.1.1c	Ref A/S ±4mm Ear loop: 200~210mm	Ref A/S ±4mm Ear loop: 200~210mm	Ref A/S ±4mm Ear loop: 200~210mm
Performance - Weight check	5.1.1c	>5.4g	5.6g	6.2~7g

ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase 1,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 512e@hkh.admgroup.com

FINAL INSPECTION REPORT



E. Photo of product and specs:



ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase 1,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 512e@hkg.admgroup.com

FINAL INSPECTION REPORT



ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase 1,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 512e@hkg.admgroup.com


FINAL INSPECTION REPORT



ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase I,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 512e@hkg.admgroup.com

FINAL INSPECTION REPORT

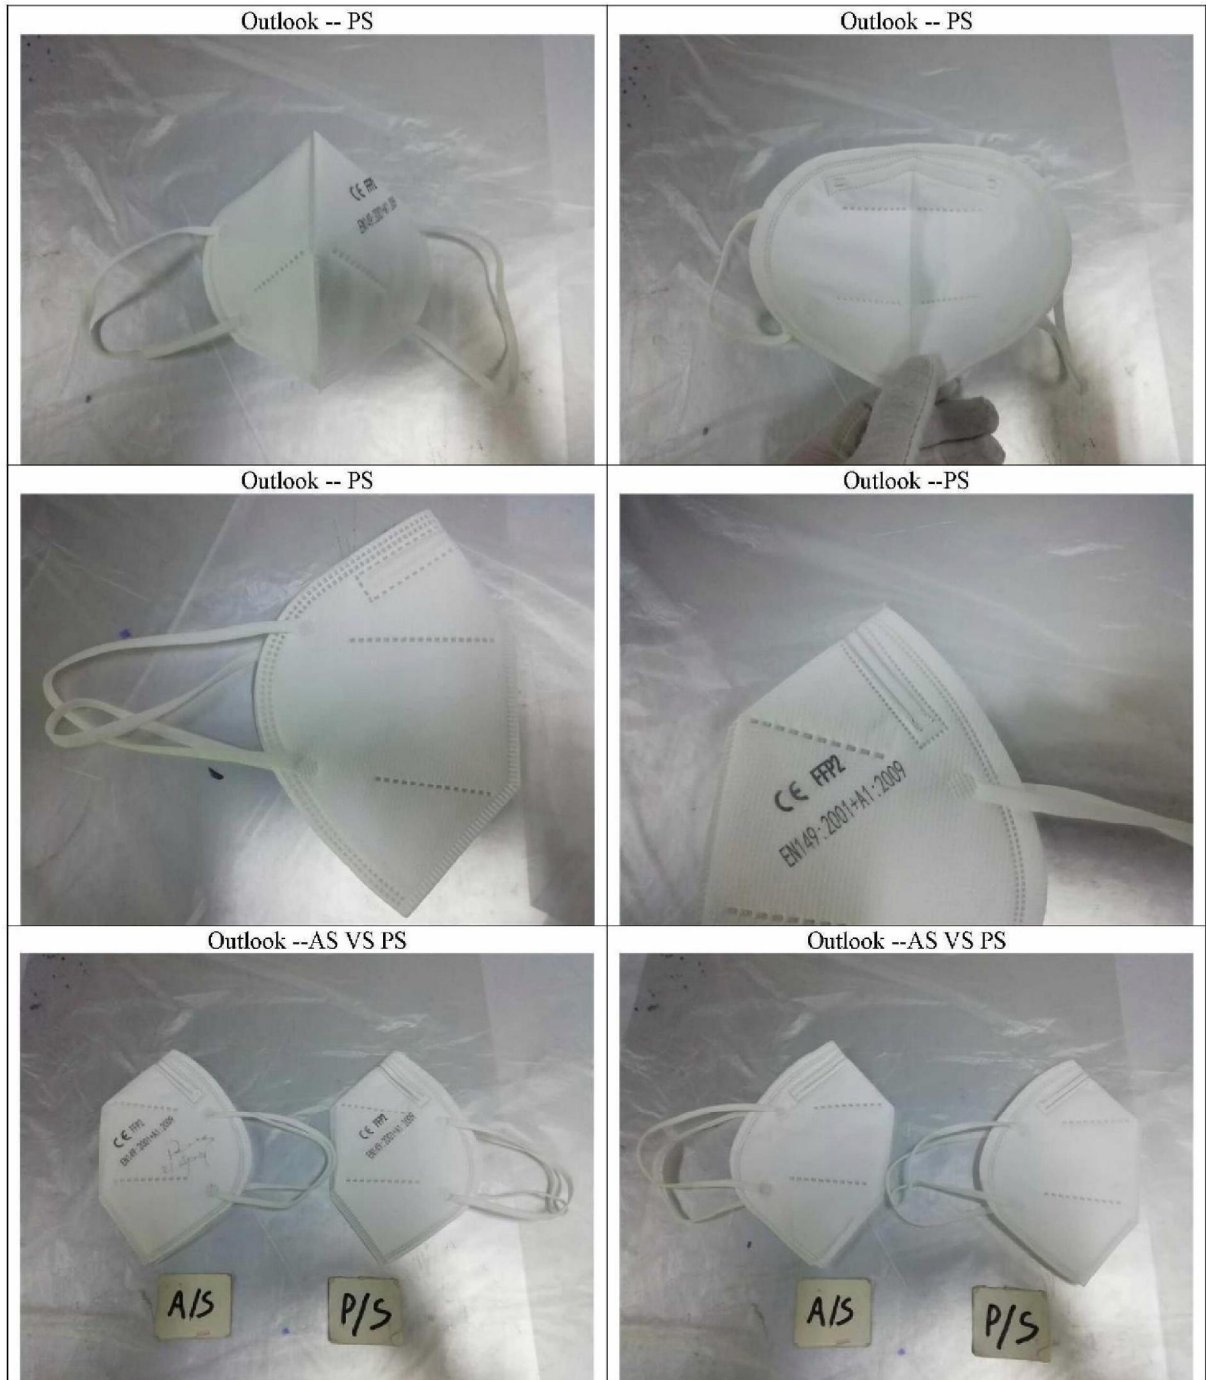

ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase 1,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 512e@hkh.admgroup.com

FINAL INSPECTION REPORT



ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase 1,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 512e@hkh.admgroup.com

FINAL INSPECTION REPORT



ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase 1,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 5.1.2e@hkh.admgroup.com

FINAL INSPECTION REPORT




ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase 1,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 512e@hkg.admgroup.com

FINAL INSPECTION REPORT




<p>On site test--Material layer quantity check</p> 	<p>On site test--Laser light through test</p> 
<p>On site test--Water leakage test</p> 	<p>On site test--Lot code check(20200406)</p> 
<p>On site test--Color fastness for rubbing</p> 	<p>On site test--Material thickness</p> 

ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase I,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 5.1.2e@hkg.admgroup.com

FINAL INSPECTION REPORT

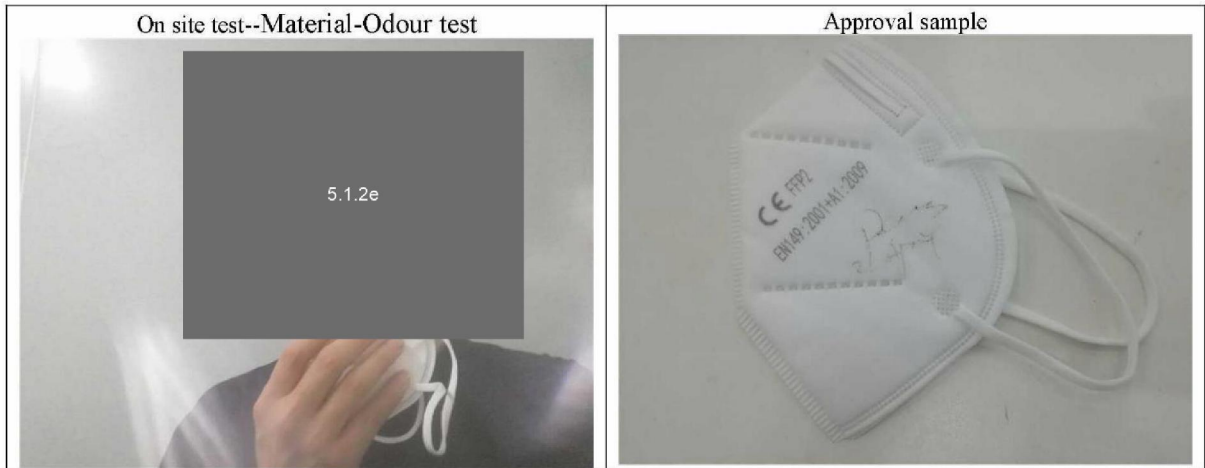

ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase 1,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 512e@hk.admgroup.com

FINAL INSPECTION REPORT




F. Photo of defect found during AQL

Critical defects:

NIL	NIL
-----	-----

Critical function defects:

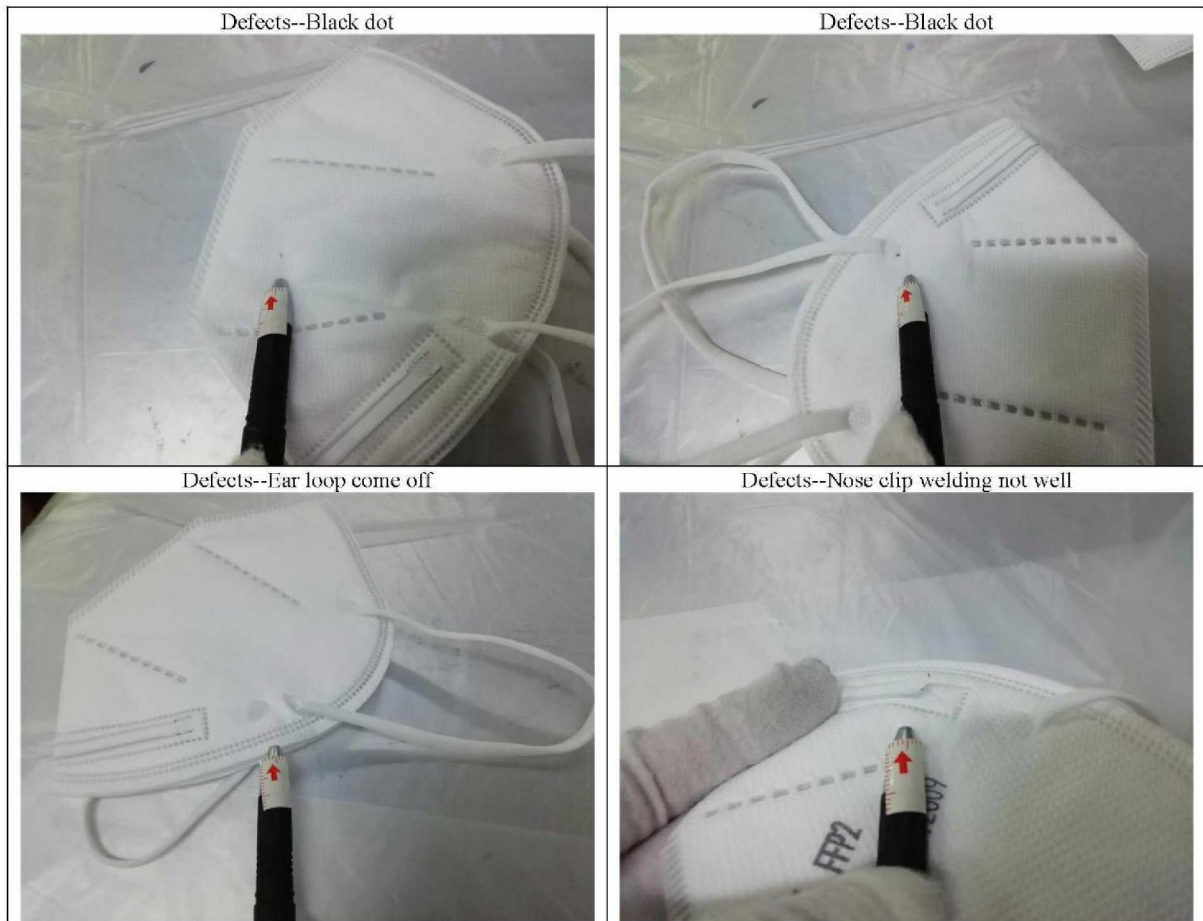

ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase I,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 512e@hkg.admgroup.com


FINAL INSPECTION REPORT



Major defects:




Minor defects:

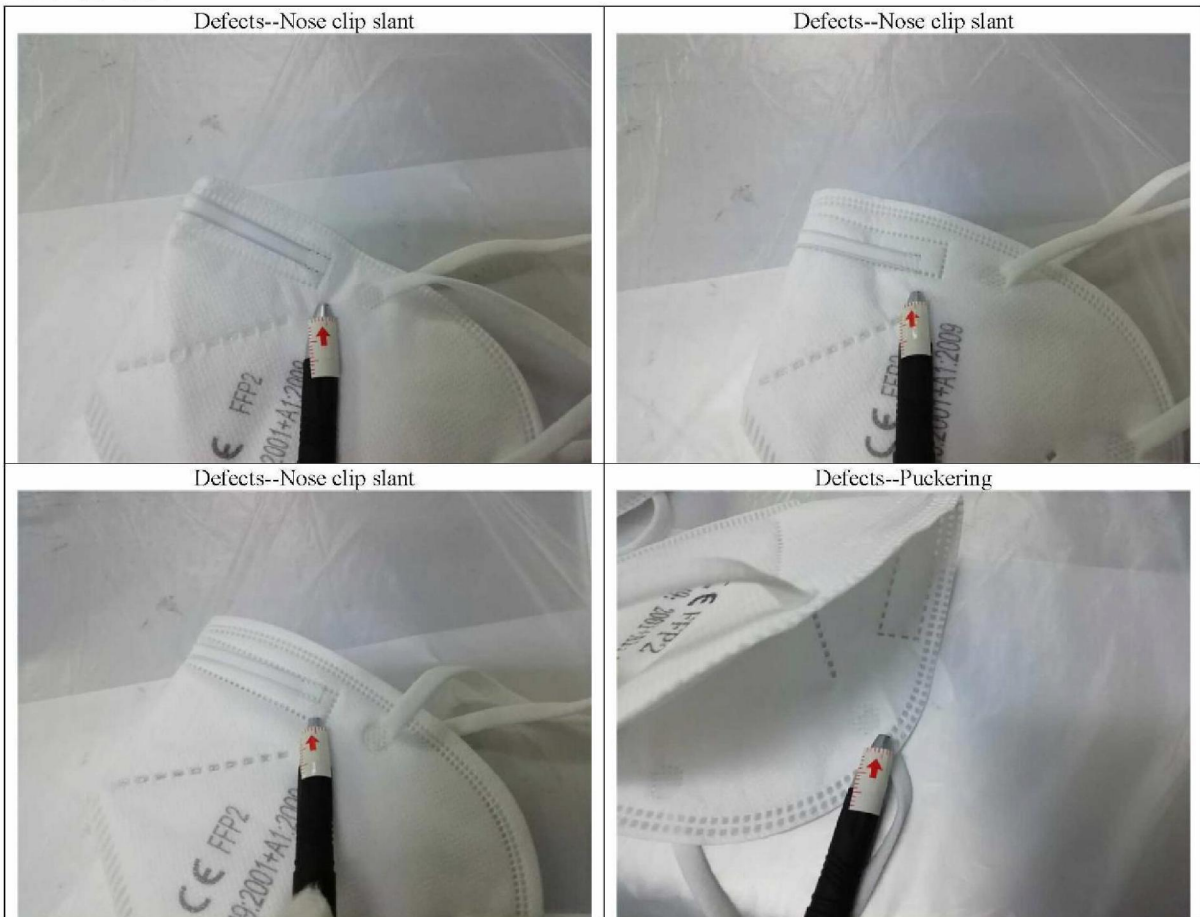

ADM Promotions Hong Kong Limited

Unit A, 4/F, Kaiser Estate, Phase 1,
No. 41 Man Yue Street, Hung Hom Kowloon, Hong Kong
Tel: (852) 27105100 / Fax: (852) 23636915
E-mail: 5.1.2e@hkg.admgroup.com

FINAL INSPECTION REPORT

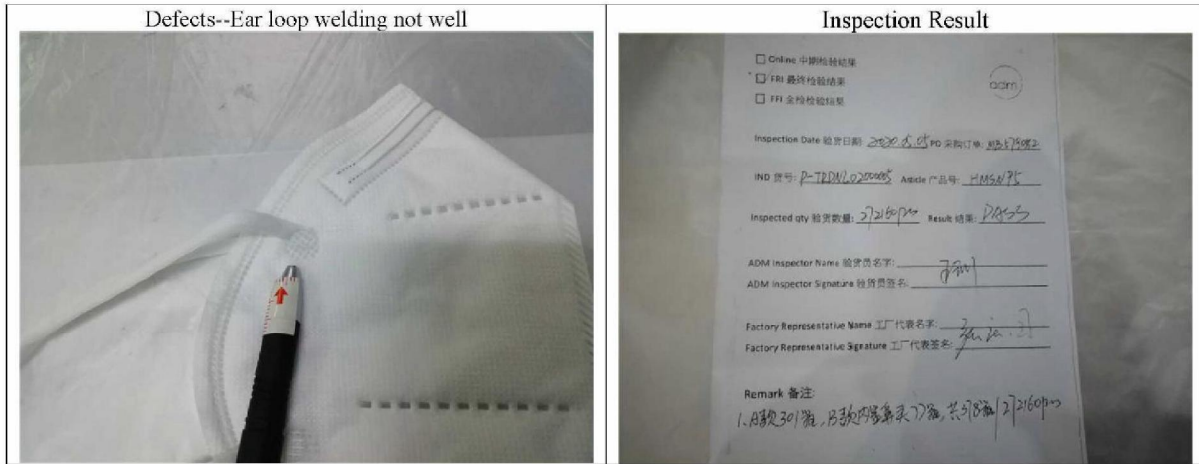

ADM Inspector:

5.1.2e

Vendor :

5.1.2e