 <b>BENCHMARKS</b> <small>Since 1993</small>   Your Partner in the Supply Chain	<h2>Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <div style="background-color: green; color: white; padding: 5px; font-weight: bold; font-size: 1.2em;">PASS</div>
		Report Date:	Apr 30, 2020	
		Page 1 of 24		

TO: ADM Promotions Hong Kong Ltd

FROM: BM Inspection Division

ATTN: 5.1.2e

ATTN: 5.1.2e

### Inspection Profile

Buyer Name	ADM Promotions Hong Kong Ltd	Product Image (front view)  
Vendor Name	Shanghai Himmers Industrial & Trading Co., Ltd	
Factory Name	Jiangsu Nanfang Medical Co., Ltd	
Article Number	HMSN95	
Product description	FFP2 MASK	
P.O. Number	578963	
Total Inspection Quantity	200160Pcs (278Ctns)	
QAP doc. Number	TRD010420D0202A	
Service Type	FRI	
Inspection Date	Apr 30, 2020	
Inspection Location	Changzhou, Jiangsu, China	

### Inspection Summary

Attributes	Result	Special Attention	Informative Remark
Section 1: Workmanship	Conformed	-	-
Section 2: Quantity Conformity	Conformed	-	-
Section 3: Product Conformity	Conformed	-	Point 3.2.1
Section 4: Packing / Marking / Labeling	Conformed	-	-
Section 5: Data Measurement / On-site test	Conformed	-	Point 5.2.1-5.2.2

### Special Attention


Nil
-----

### Informative Remark

3.2.1 Actual product with 5 layers (2 layer of non-woven cloth, 2 layer of molten cloth, 1 layer of needle cloth), conformed to approved sample. But QAP shows it was 4 layers (2 layer of non-woven cloth, 1 layer of molten cloth, 1 layer of needle cloth), it was accepted by client.
5.2.1 The thickness of 2 layers of molten cloth add up conformed to client's spec. 0.23mm
5.2.2 One shipment sample was sealed at the factory.

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> <small>Since 1993</small> Your Partner in the Supply Chain	<h2>Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <b>PASS</b>
		Report Date:	Apr 30, 2020	
		Page 2 of 24		

### Section 1: Workmanship

<b>Result:</b>
<b>Conformed</b>

<b>Standard adopted:</b> Single sampling plan for Normal inspection: ISO2859-1:1999 General sampling level: S-4 Sample size: 125 units		<b>AQL:</b> Critical Safety : Not allowed Critical Function: 0.4 Critical Function + Major: 1.0 Minor: 2.5			
Item No.	Defect Description	CRS	CRF	CRF+MAJ	MIN
HMSN95	Too thin edge	-	-	1	1
	Different length of ear loop	-	-	1	-
	Wrinkle on front	-	-	-	1
	Poor fixed of ear loop	-	-	-	1
<b>Total Found</b>		<b>0</b>	<b>0</b>	<b>2</b>	<b>3</b>
<b>Max. Allowed</b>		<b>0</b>	<b>1</b>	<b>2</b>	<b>5</b>



#### 1.1 Special Attention

Nil

#### 1.2 Informative Remarks


Nil




#### 1.3 Defect Photos

	
Too thin edge -Maj	Too thin edge -Min

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> <small>Since 1993</small>   Your Partner in the Supply Chain	<h2>Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <b>PASS</b>
		Report Date:	Apr 30, 2020	
		Page 3 of 24		

	
Different length of ear loop-Maj	Wrinkle on front-Min
	Nil
Poor fixed of ear loop-Min	Nil

## Section 2: Quantity Conformity

Result:
Conformed

PO No.	Item No.	Order Qty.		Quantity available(pcs)			Sample size(pcs)	
		Pcs	CTNs.	Packed	Not packed	Not finished	Packed	Not packed
578963	HMSN95	200,160	278	200,160	0	0	125	0
<b>Total:</b>		<b>200,160</b>	<b>278</b>	<b>200,160</b>	<b>0</b>	<b>0</b>	<b>125</b>	

### 2.1 Special Attention


Nil

### 2.2 Informative Remarks

Nil

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> <small>Since 1993</small> Your Partner in the Supply Chain	<h2>Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <div style="background-color: green; color: white; padding: 5px; font-weight: bold;">PASS</div>
		Report Date:	Apr 30, 2020	
		Page 4 of 24		

### Section 3: Product Conformity

Result:
Conformed

1	Product Specification(Size/Color/Style) Conformity	Conformed
2	Gold Seal Sample Conformity	Conformed
3	Instruction Manual Conformity	Not Available

#### 3.1 Special Attention

Nil

#### 3.2 Informative Remarks

Point:3.2.1

### Section 4: Packing / Marking / Labeling

Result:
Conformed

1	Packages Conformity	Conformed
2	Shipping Marks Conformity	Conformed
3	Labeling Conformity	Conformed
4	Barcode Conformity	N/A

#### 4.1 Dimension & Gross Weight

Item No.	Attribute	Qty per CTN	Qty per INNER	Cardboard (3/5/7-Ply)	Dimensions (L x W x H cm)	Gross weight ( Kgs )
HMSN95	Outer carton	720pcs	30pcs	5	60x35.2x36cm	6.73

#### 4.1 Special Attention

Nil

#### 4.2 Informative Remarks

Nil


### Section 5: Data measurement / On-site test

Result:
Conformed

No.	Test Item	Samples	Requirement	Test Result
1	Carton number check	Whole lot	All master carton must filled with carton number.	N/A as not required for this shipment.
2	Carton transit drop test	1ctn	1 corner, 3 edges, 6 panels, 10 times drop on concrete floor 66cm. No broken of product and package.	Conformed
3	Product size check	13pcs	155X105mm +/-3%	Conformed
4	Product net weight	13pcs	6.3g, No less than 6g.	Conformed
5	Product fitting check	3pcs	Must fit the adult's head, easy to wear and remove, 25 cycles per minute, 20 minutes, cannot be damaged.	Conformed
6	Nose clip check	8pcs	Each mask must be equipped with a nose clip, folded	Conformed

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> <small>Since 1993</small>   Your Partner in the Supply Chain	<h2>Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <div style="background-color: green; color: white; padding: 5px; font-weight: bold; font-size: 1.2em;">PASS</div>
		Report Date:	Apr 30, 2020	
		Page 5 of 24		

			20times repeatedly, and must not break.	
7	Mask straps check	8pcs	Apply a 10N pull, the mask strap and the body cannot be detached. Stretch length should not be less than 2 times the length.	Conformed
8	Flame retardant check	3pcs	After leaving the flame, continue to burn no more than 5seconds.	Conformed
9	Fabric humidity check	13pcs	6%,Must under 10%.	Conformed
10	Unit quantity in package check	3ctns	5pcs per polybag, 30pcs per box, 720pcs per carton.	Conformed
11	Material odor test	125pcs	Without any pleasant odor when open the package and product.	Conformed
12	Selling unit package check	800units	Without defect was found	Conformed

### 5.1 Special Attention


Nil

### 5.2 Informative Remarks

Point 5.2.1-2

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

*The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.*

	<h2 style="margin: 0;">Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <span style="font-size: 1.2em; font-weight: bold; color: white; background-color: green; padding: 5px;">PASS</span>
		Report Date:	Apr 30, 2020	
		Page 6 of 24		


### Attachment Photos

#### 1 Package and Product Photos

	
Master carton view	Carton top marking
	
Shipping mark	Shipping mark

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> <small>Since 1993</small> Your Partner in the Supply Chain	<h2>Inspection Report</h2>	Report No.:	TJ200400847	Overall Result
		Report Date:	Apr 30, 2020	
		Page 7 of 24		



Shipping mark



Shipping mark



Shipping mark



Side mark




Side mark



Side mark


Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

	<h2>Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <span style="background-color: green; color: white; padding: 5px; font-weight: bold;">PASS</span>
		Report Date:	Apr 30, 2020	
		Page 8 of 24		



Open carton

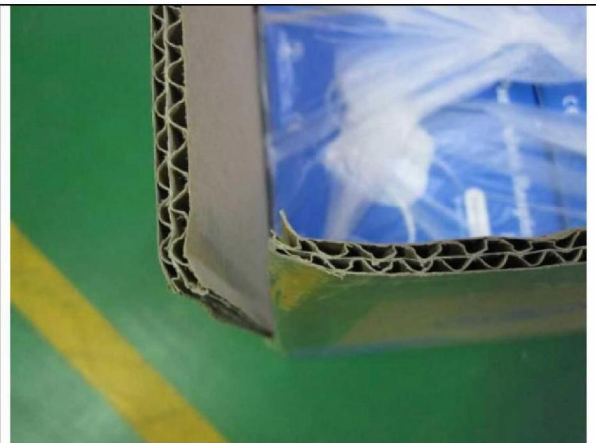


5-ply carton



3 layers



Gift box view

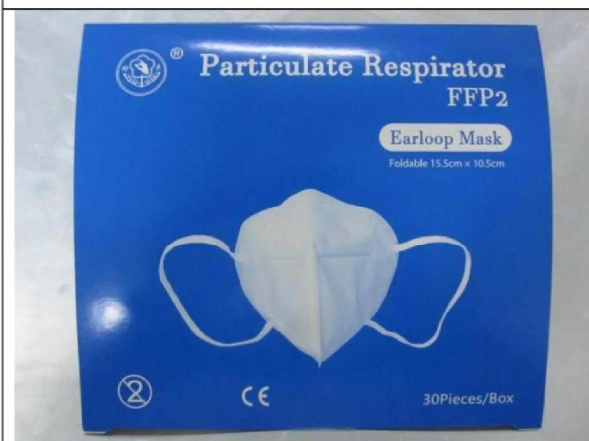


Top view



Detailed marking


Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> <small>Since 1993</small>   Your Partner in the Supply Chain	<h2 style="margin: 0;">Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <b>PASS</b>
		Report Date:	Apr 30, 2020	
		Page 9 of 24		



Detailed marking

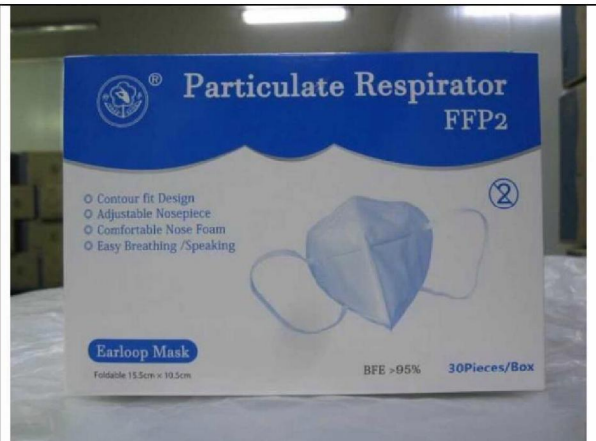

Box front view




Detailed marking



Detailed marking




Box back view

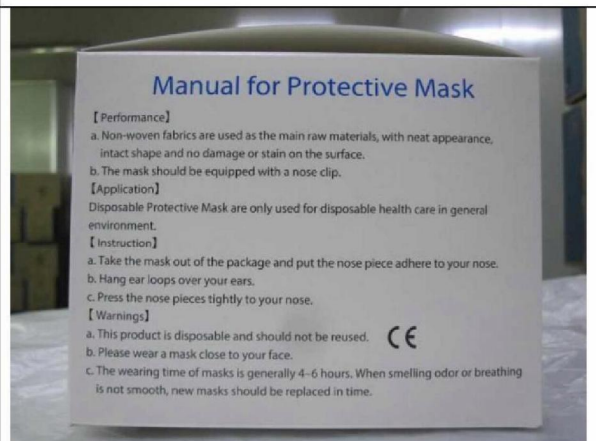

Box side view

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> Since 1993   Your Partner in the Supply Chain	<h1>Inspection Report</h1>	Report No.:	TJ200400847	<b>Overall Result</b>  <div style="background-color: green; color: white; padding: 5px; font-weight: bold; font-size: 1.2em;">PASS</div>
		Report Date:	Apr 30, 2020	
		Page 10 of 24		




Box side view




Box bottom view



Transparent tape

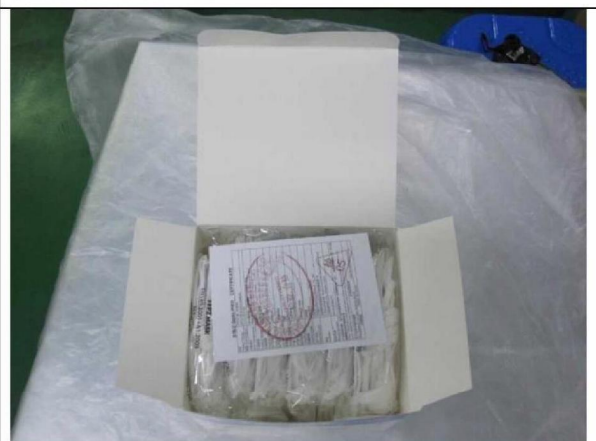

Open box

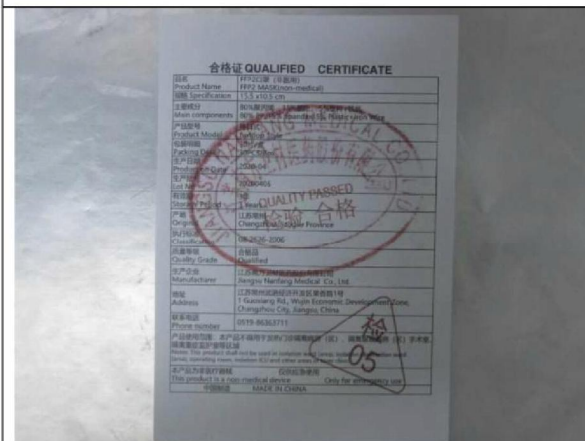


Qualified certificate



6 bags per box

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> <small>Since 1993</small> Your Partner in the Supply Chain	<h2 style="margin: 0;">Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <div style="background-color: green; color: white; padding: 5px; font-weight: bold; font-size: 1.2em;">PASS</div>
		Report Date:	Apr 30, 2020	
		Page 11 of 24		



Single package view



Single package view



Product



Polybag




5pcs per bag



Single product view

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> <small>Since 1993</small>   Your Partner in the Supply Chain	<h2>Inspection Report</h2>	Report No.:	TJ200400847	Overall Result
		Report Date:	Apr 30, 2020	
		Page 12 of 24		



Product view



Product view



Product view



Product view




5 layers



5 layers

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

*The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.*


	<h2>Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <span style="background-color: green; color: white; padding: 5px; font-weight: bold;">PASS</span>
		Report Date:	Apr 30, 2020	
		Page 13 of 24		



Nose clip



Compared with approved sample

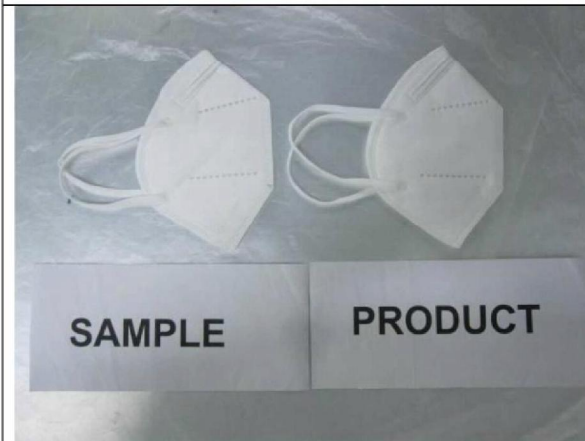

Compared with approved sample



Compared with approved sample




Compared with approved sample







Signature on sample

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.


	<h2 style="margin: 0;">Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <span style="background-color: green; color: white; padding: 5px; font-weight: bold;">PASS</span>
		Report Date:	Apr 30, 2020	
		Page 14 of 24		

### 2 Data Measurement and On-site Test Photos

	
Gross weight check	G.W. 6.73KG
	
Carton size check	L: 60cm

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

*The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.*

 <b>BENCHMARKS</b> <small>Since 1993</small> Your Partner in the Supply Chain	<h2 style="margin: 0;">Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <div style="background-color: green; color: white; padding: 5px; text-align: center; font-weight: bold;">PASS</div>
		Report Date:	Apr 30, 2020	
		Page 15 of 24		



Carton size check

W: 35.2cm



Carton size check

H: 36cm




Weight of gift box

244.6g

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.


 <b>BENCHMARKS</b> <small>Since 1993</small> Your Partner in the Supply Chain	<h2>Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <div style="background-color: green; color: white; padding: 5px; font-weight: bold;">PASS</div>
		Report Date:	Apr 30, 2020	
		Page 16 of 24		



Gift box size check



L:16.3cm

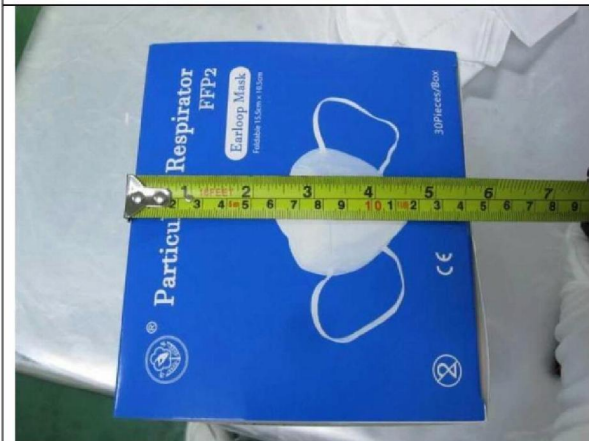


Gift box size check



L:14.3cm




Gift box size check

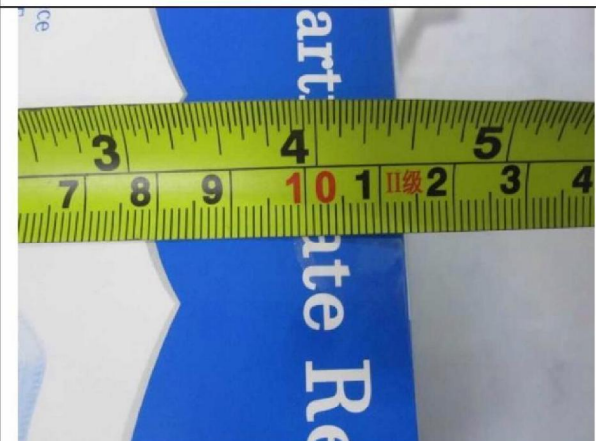

H: 11.3cm

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <p><b>BENCHMARKS</b> Since 1993   Your Partner in the Supply Chain</p>	<h2>Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <span style="background-color: green; color: white; padding: 5px; font-weight: bold;">PASS</span>
		Report Date:	Apr 30, 2020	
		Page 17 of 24		



Single package weight: 31.7g



N.W.: 6.2g



Product size check



104mm




Product size check



153mm

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.


 <p><b>BENCHMARKS</b> Since 1993   Your Partner in the Supply Chain</p>	<h2>Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <span style="background-color: green; color: white; padding: 5px; font-weight: bold;">PASS</span>
		Report Date:	Apr 30, 2020	
		Page 18 of 24		



Product size check



67mm

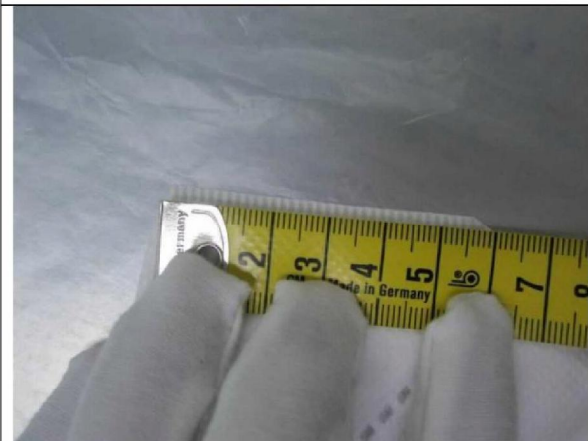

Product size check: 56m



Earloop length check




L:204mm



Earloop length check

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

	<h2 style="margin: 0;">Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <span style="background-color: green; color: white; padding: 5px; font-weight: bold;">PASS</span>
		Report Date:	Apr 30, 2020	
		Page 19 of 24		



L: 202mm



Nose clip length: 85mm



1<sup>st</sup> layer non-woven cloth thickness: 0.32mm



2<sup>nd</sup> layer molten cloth thickness: 0.12mm




3<sup>rd</sup> layer molten cloth thickness: 0.28mm



4<sup>th</sup> layer molten cloth thickness: 0.105mm

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

	<h2 style="margin: 0;">Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <span style="background-color: green; color: white; padding: 5px; font-weight: bold;">PASS</span>
		Report Date:	Apr 30, 2020	
		Page 20 of 24		



5<sup>th</sup> layer non-woven cloth thickness-0.27mm



3M testing



3M testing



Rubbing testing



Rubbing testing



Basic function of ear loop check

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> <small>Since 1993</small>   Your Partner in the Supply Chain	<h2 style="margin: 0;">Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <div style="background-color: green; color: white; padding: 5px; font-weight: bold; font-size: 1.2em;">PASS</div>
		Report Date:	Apr 30, 2020	
		Page 21 of 24		



Basic function of ear loop check



Ear strap strength test 1kgs weight(10N)



Ear strap strength test 1kgs weight(10N)



Nose clip bending life test




Nose clip bending life test



Product fitting check

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

	<h3 style="text-align: center;">Inspection Report</h3>	Report No.:	TJ200400847	<b>Overall Result</b>
		Report Date:	Apr 30, 2020	
		Page 22 of 24		



Product fitting check



Outside layer non-woven waterproof check



Outside layer non-woven waterproof check



Middle layer meltblown electrostatic adsorption test




Flame retardant check




Flame retardant check

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

 <b>BENCHMARKS</b> <small>Since 1993</small>   Your Partner in the Supply Chain	<h2>Inspection Report</h2>	Report No.:	TJ200400847	Overall Result
		Report Date:	Apr 30, 2020	
		Page 23 of 24		

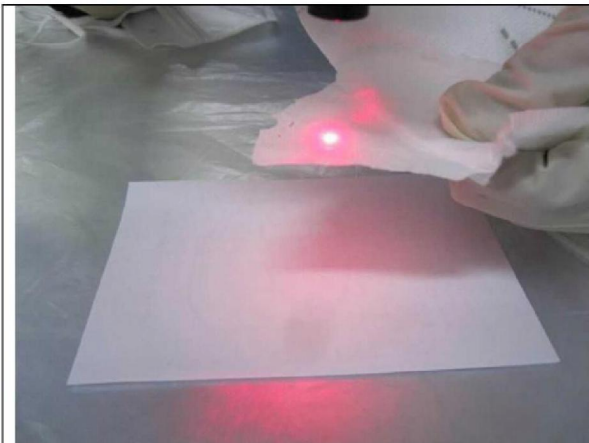


Fabric density check



Fabric humidity check

### 3 Other Photos(Storage, Sample Comparison)

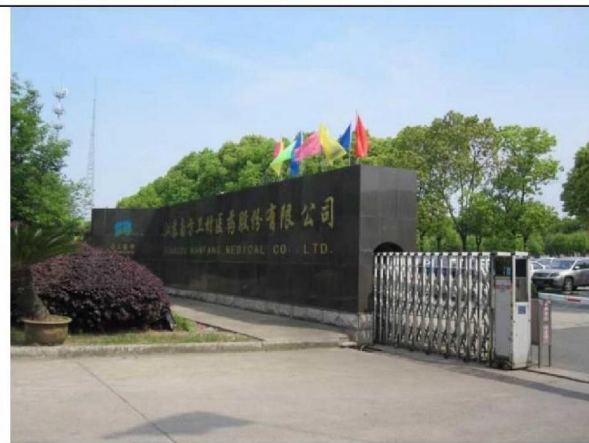


Factory gate



Factory gate

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

*The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.*

	<h2 style="margin: 0;">Inspection Report</h2>	Report No.:	TJ200400847	<b>Overall Result</b>  <span style="background-color: green; color: white; padding: 5px; font-weight: bold; font-size: 1.2em;">PASS</span>
		Report Date:	Apr 30, 2020	
		Page 24 of 24		



Warehouse



Warehouse



Sealed shipment samples to client

Nil

Nil

-----The End-----

Address: Unit 20,5/F., Block B, Proficient Industrial Centre, 6 Wang Kwun Road, Kowloon Bay, Hong Kong

*The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.*